



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200
Fax 613 632-5246

②

D119-796-241TRN
Job Sheet 187573



Part No: D119-796-241TRN

Job Qty: 1 ea

Part Name: Crosstube Turning Detail



Part Weight: 0 lbs

Status: New

Priority: Medium

Job Created: 12/7/18

Job Tracking No:

Due Date: 1/4/19

Created By: Jesse White

Type: Stock

Description:

Note: DWG REV J IPP REV A RQ 14/05/27 VERIFIED BY DD IPP REV: P 16.05.04 AS PER DWG REV.I DD
VERF:JLM

Ship Via:

Bill of Materials

Job Routing

Op No	Operation	Qty	Start Date	Due Date	Standard		Workcenter/Supplier		Sign-off
					Setup Hrs	Run Hrs	Workcenter / Supplier	Lead Time	
90	Start up Operation	1 Ea	1/4/19	1/4/19	0.00	0.00	Start Up Crosstubes-1		MD 2018-12-17
100	Mori Seiki	1 pcs	1/4/19	1/4/19	1.77	1.72	Mori Seiki TL-40		MD 2018-12-20
110	QC	1 pcs	1/4/19	1/4/19	0.00	0.00	QC2-1		MD 2019-01-09
120	Mori Seiki	1 pcs	1/4/19	1/4/19	0.00	1.72	Mori Seiki TL-40		DAS 19-02-08
130	QC	1 pcs	1/4/19	1/4/19	0.00	0.00	QC2-1		67 19-02-08
140	QC	1 pcs	1/4/19	1/4/19	0.00	0.00	QC8		889 GP
145	Crosstubes	1 pcs	1/4/19	1/4/19	0.00	0.45	Crosstubes-1		DAS 19-02-08
150	HandFXtube	1 pcs	1/4/19	1/4/19	0.00	0.33	Crosstubes-3		DAS 19-02-08
160	QC	1 pcs	1/4/19	1/4/19	0.00	0.00	QC7-1		67 19-02-08
170	Packaging	1 pcs	1/4/19	1/4/19	0.00	0.00	Packaging3-1		21 9-89 MAR 11 2019
180	QC21-FG	1 Ea	1/4/19	1/4/19	0.00	0.00	QC21		21 9-89 MAR 11 2019

Part Op 100 - 1-Fill tube with sand & install plugs on both ends as per Folio FB298 2-Turn first side as per Folio FB298
Descriptions: 120 - 1-Turn second side as per Folio FB298
145 - GRIND ONLY TRANSITION LINES SMOOTH LONGITUDE WAY.
150 - 1- handfinish X-TUBE INSIDE AND OUT
170 - LOCATION : LG014

Job BOM

Part / Item	Component Name	Quantity	Operation	Container
D6023-106	Crosstube Material	1 Ea (1 ea)	90-Start up Operation	BO13 837

Job Allocations

Operation	Component Part	Required	Inventory	Allocated
90-Start up Operation	D6023-106	1	25	0

Part Specifications

Specifications could not be found.

Plex 12/7/18 2:30 PM dart.white.jesse

(2)

DART AEROSPACE LTD	Work Order: 187573
Description: Crosstube Assembly (AW119 MKII Aft)	Part Number: D119-796-241TRN
Inspection Dwg: D119-796-241 Rev: J	Page 1 of 2

FIRST ARTICLE INSPECTION CHECKLIST

	Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	5.88	+/-0.030	5.884	✓		CNC-08	
	2.516	+0.005/-0.000	2.521	✓		CNC-04	
	2.626	+0.005/-0.000	2.630	✓			
	2.627	+0.005/-0.000	2.632	✓			
	2.798	+0.005/-0.000	2.803	✓			
	2.799	+0.005/-0.000	2.804	✓			
	2.989	+0.005/-0.000	2.994	✓			
	3.191	+0.005/-0.000	3.196	✓		CNC-05	
	3.200	+0.005/-0.000	3.205	✓		"	
SIDE B	5.88	+/-0.030	5.872	✓		CNC-08	
	2.516	+0.005/-0.000	2.521	✓		CNC-04	
	2.626	+0.005/-0.000	2.631	✓			
	2.627	+0.005/-0.000	2.632	✓			
	2.798	+0.005/-0.000	2.803	✓			
	2.799	+0.005/-0.000	2.803	✓			
	2.989	+0.005/-0.000	2.994	✓			
	3.191	+0.005/-0.000	3.196	✓		CNC-05	
	3.200	+0.005/-0.000	3.205	✓		"	
	105.71	+/-0.020	105.700	✓		Tape	

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____


Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor		
			QC / QA Coordinator		
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

②

DART AEROSPACE LTD	Work Order: 187573
Description: Crosstube Assembly (AW119 MKII Aft)	Part Number: D119-796-241TRN
Inspection Dwg: D119-796-241 Rev: J	Page 2 of 2

WALL THICKNESS MEASUREMENT

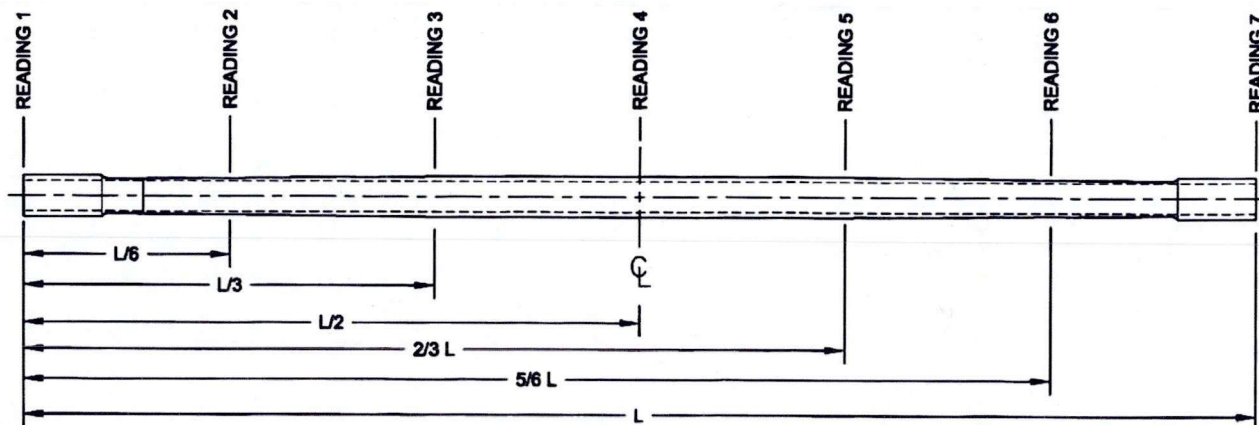

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation Δw (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L= 0"	.128	.121	.132	.138	.017	0.030"
READING 2 L= 17.618	.191	.201	.215	.208	.024	
READING 3 L= 35.236	.291	.302	.317	.309	.026	0.063"
READING 4 L= 52.855	.478	.465	.477	.483	.018	
READING 5 L= 70.473	.311	.303	.298	.304	.013	
READING 6 L= 88.092	.205	.194	.202	.211	.017	0.030"
READING 7 L= 105.710	.133	.127	.128	.134	.007	

Calibration Result

Actual Block Thickness: 100-500

SITESCAN 250 Measured Thickness: 100-500

Measured by: MD	Audited by: DAS 67 9-89	Preliminary Approval:
Date: 2019-01-09	Date: 19-02-05	Date:

Rev	Date	Change	Revised by	Approved
B	15.03.12	Dimensions updated per Dwg Rev F (P/O D119-796-201)	KJ	
C	15.04.14	Tolerance dimensions revised on Wall Thickness table	KJ	
D	15.05.14	Tolerances revised per Dwg Rev G	KJ	
E	15.09.09	Dwg Rev updated	KJ	
F	16.05.27	Dwg Rev updated	KJ	
G	17.07.12	Dwg Rev updated	KJ	
H	18.05.24	Tolerance dimensions revised on Wall Thickness table	MG	

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date : _____	Sequence #: _____	QTY Affected : _____		MRB (QSI042) _____	
Description Work Order Deviation		Disposition		Completed By	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details: _____					

D119-796-241 XTUBE ASSY (AW119 MKII AFT)

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: MASK D5134-041/-042 DAMPER SUPPORT ASSEMBLIES, CUFFS, D5136-1/-2 CONTACT PADS, THE COMPLETE CIRCUMFERENCE OF THE TUBE UNDER THE D5122-1 CENTER SUPPORT AND THE TAB ON THE D5515-1 GROUNDING CLAMP PRIOR TO APPLICATION OF CLEAR COAT/PAINT.
IF NECESSARY TOUCH UP PRIMER ON OUTSIDE OF CROSSTUBE PER DART QSI 005 4.2.
APPLY MATTE CLEAR COAT TO THE UNDERSIDE OF CROSSTUBE AS SHOWN (B4-2, HATCHED AREA) PER QSI 005 4.2.
MASK THE UNDERSIDE OF CROSSTUBE AS SHOWN (B4-2, HATCHED AREA).
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: IDENTIFY USING PART NUMBER "D119-796-241" AND BATCH NUMBER
ON INSIDE OF CUFF PER QSI 044 6.4
- 7) WEIGHT: 26.26 lbs
- 8) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE.
THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM DEFECTS SUCH AS SCRATCHES, NICKS OR DENTS. DEFECTS UP TO 0.005 MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 9) INSTALL D5122-1 CENTER SUPPORT HAND TIGHT ONLY. DO NOT TORQUE. INSTALL RED TAG TO INDICATE "D5122-1 CENTER SUPPORT MUST BE BONDED PER IIN-D119-796 PRIOR TO FLIGHT".
- 10) PRIOR TO FINISHING, ABRASE MATING SURFACES OF D5136-1/-2 AND SURFACE OF CROSSTUBE WITH SCOTCH BRITE 7447 RED AND REMOVE RESIDUE WITH DUPONT 4105S WASH 'N' WIPE DEGREASER. APPLY A 0.100" MIN THK LAYER OF PROSEAL 890 ON THE INSIDE CONCAVE SURFACE OF THE D5136-1/-2 CONTACT PADS AND INSTALL AT AN 8.4° OFFSET FROM THE CROSSTUBE BENDING PLANE. INSTALL MS21920-25 CLAMPS AND D5123-5 CLAMP CUSHIONS WHILE WET. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.
- 11) TORQUE MS21920 CLAMPS 80 - 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY. THE NUT HAS NOT BOTTOMED-OUT AFTER TORQUING AND THE NUT IS FACING AFT.
- 12) PRIOR TO FINISHING, POSITION AND INSTALL D5134-041/-042 DAMPER SUPPORTS USING JIG DT10085. ABRASE MATING SURFACES OF THE D5134-041/-042 DAMPER SUPPORTS AND CROSSTUBE WITH SCOTCH BRITE 7447 RED AND REMOVE RESIDUE WITH DUPONT 4105S WASH 'N' WIPE DEGREASER. APPLY A 0.100" MIN THK LAYER OF PROSEAL 890 ON THE INSIDE CONCAVE SURFACE OF THE D5134-041/-042. INSTALL MS21920-25 CLAMPS AND D5123-1 CLAMP CUSHIONS WHILE WET. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS. ENSURE THAT THE MS21920 CLAMPS ARE POSITIONED AS SHOWN IN DETAIL C.
- 13) PRIOR TO FINISHING, ABRASE MATING SURFACES OF CROSSTUBE AND D5152-043 WITH SCOTCH BRITE 7447 RED AND REMOVE RESIDUE WITH DUPONT 4105S WASH 'N' WIPE DEGREASER. INSTALL D5152-043 WITH LAYER OF PROSEAL 890 ON INSIDE CONCAVE SURFACE, 0.100" MIN THK LOCATE D5152-043 USING TOOL DT10112.
- 14) INSTALL THE D5515-1 GROUNDING CLAMP AND ASSOCIATED HARDWARE PER DETAIL "C" PRIOR TO FINISHING. TORQUE THE MS21042-3 NUT 12-15 IN-LB. COMPLETELY SEAL THE EDGES OF THE CLAMP USING PROSEAL 890.
- 15) CARRY OUT A RESISTANCE CHECK BETWEEN THE D5515-1 GROUNDING CLAMP AND ANY UNPAINTED SECTION OF THE CROSSTUBE IN ACCORDANCE WITH AC43-13-1B CHAPTER 11. MAXIMUM RESISTANCE IS 3 MILLIOHMS.

RELEASED
2017-05-04
ECN 17-536

J	ADD NOTE 14 & 15 ON SHT 1, ADD PAINT/PRIMER MASKING LOCATIONS, REVISE NOTES ON SHT 1 & 4, REVISE BOM ON SHT 2 TO ADD GROUNDING CLAMP AND ASSOCIATED HARDWARE. REF PAR 17-580	ML	17.02.10
I	D6023-106 MATERIAL REPLACES D6009-106, D5136-1/-2 & D5134-041/-042 NOW INSTALLED ON PRIMER	AP	15.10.13
H	NOTE 9 RE-WRITTEN, BONDING INSTRUCTIONS MOVED TO IIN. SEE PREVIOUS REV FOR DETAILS.	AP	15.07.02
G	FINISHING ORDER ADJUSTED, UPDATE BEND TOLERANCE AND TRN DETAIL TOLERANCE TO MATCH D119-796-141 DWG	AP	15.04.24
F	REMOVED PRIMER/PAINT ON CUFFS, 2.516 WAS 2.500 (C8-5)	AP	15.02.03
E	D5152-043 WAS D5150-3, SCOTCH BRITE 7447 RED WAS 180 GRIT SANDPAPER	DB	15.01.15
D	ADD D5150-3 STEP POST (2X), MOVED INSPECTION WINDOW DETAIL TO SHT 1, MODIFIED NOTES ON SH 1 & 3	DB	14.11.25
C	CR3212-4-07 RIVETS WAS CR3212-4-05 RIVETS, RADIUS BLOCK WAS NUT PLATE ASSEMBLY (BOM), REMOVED 7.5 DEG CUFF HOLE OFFSET (A1-3), REDUCED CUFF DIA TO 2.500 (C8-5), ADD INSPECTION WINDOW	AP	14.10.23
B	ORIENTATION OF D5122-1 CENTER SUPPORT WAS CORRECTED. D5123-5 ADDED UNDER D5136-1/-2 CONTACT PADS, ADDED D2873-043 NUT PLATE ASSY & CR3212-4-05 RIVETS, ADDED REFERENCE TO SKIDTUBES FOR LOCATING CUFF HOLES, RE-ORGANIZED NOTES, REMOVED REDUNDANT INFORMATION.	AP	14.09.08
A	NEW ISSUE	AP	14.08.07
REV.	DESCRIPTION	BY	DATE
DESIGN	AP	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	ML		
CHECKED	JMH	DRAWING NO.	REV. J
MFG. APPR.	DP	D119-796-241	SHEET 1 OF 7
APPROVED	WM	TITLE	SCALE
DE APPR.	DS	XTUBE ASSY (AW119 MKII AFT)	NTS
DATE	17.02.10	COPYRIGHT © 2014 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

APPROVED

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition			Completed By
					Lead hand / Supervisor
					QC / QA Coordinator
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

ITEM	QTY	P/N	DESCRIPTION
	X	D119-796-241	XTUBE ASSY (AW119 MKII AFT)
1	1	D119-796-241BND	CROSSTUBE, AFT
2	4	D2873-043	RADIUS BLOCK
3	1	D5122-1	CENTER SUPPORT
4	6	D5123-1	CLAMP CUSHION
5	2	D5123-5	CLAMP CUSHION
6	1	D5134-041	DAMPER SUPPORT ASSY, LH
7	1	D5134-042	DAMPER SUPPORT ASSY, RH
8	1	D5136-1	CONTACT PAD, LH
9	1	D5136-2	CONTACT PAD, RH
10	2	D5152-043	AFT POST MOUNT ASSY
11	2	D5515-1	GROUNDING CLAMP
12	16	CR3212-4-07	CSK RIVET, CHERRY MAX
13	6	MS21920-25	CLAMP
14	2	MS21920-28	CLAMP
15	2	MS27039-1-08	SCREW, PAN-HEAD
16	2	MS21042-3	NUT
17	4	NAS1149D0332J	WASHER

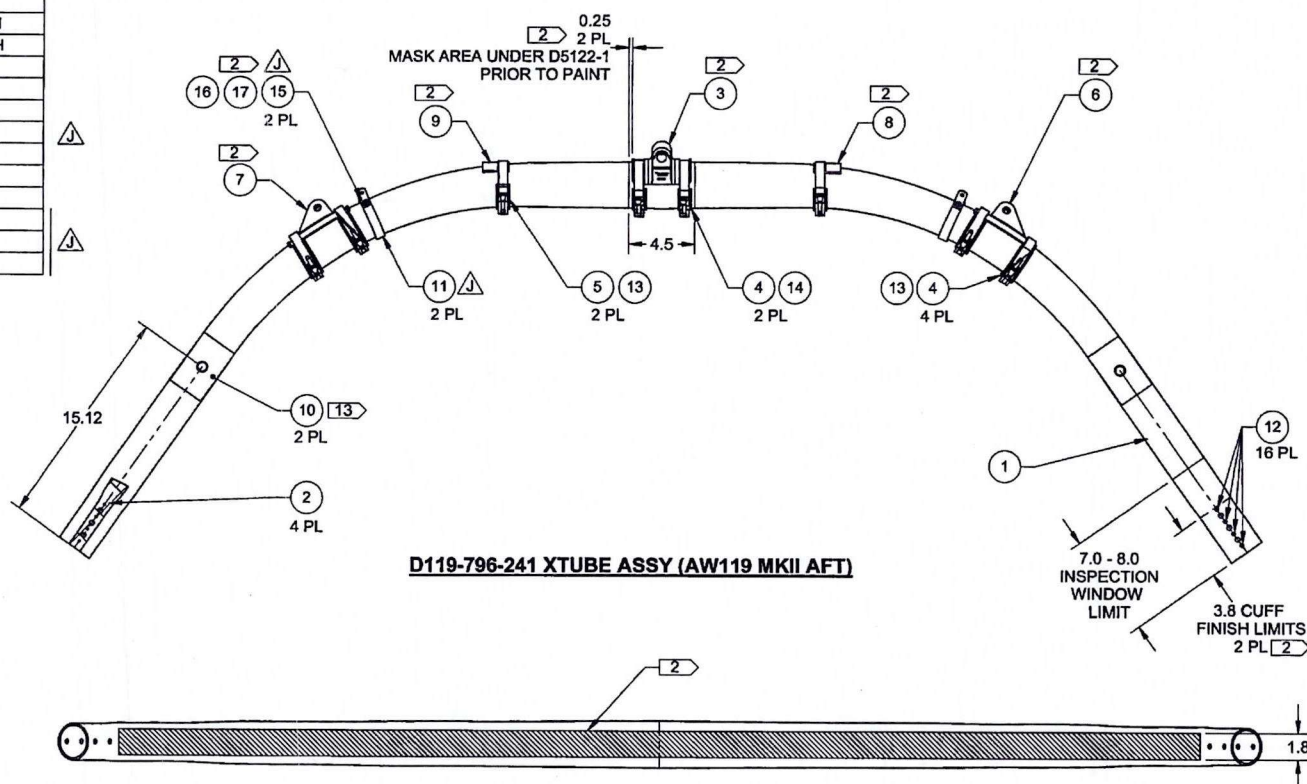

RELEASED
2017-05-04

APPROVED

DESIGN	AP	DART AEROSPACE LTD	
DRAWN	ML	HAWKESBURY, ONTARIO, CANADA	
CHECKED	JMH	DRAWING NO.	REV. J
MFG. APPR.	DP	D119-796-241	SHEET 2 OF 7
APPROVED	WM	TITLE	SCALE
DE APPR.	DS	XTUBE ASSY (AW119 MKII AFT)	NTS
DATE	17.02.10	COPYRIGHT © 2014 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

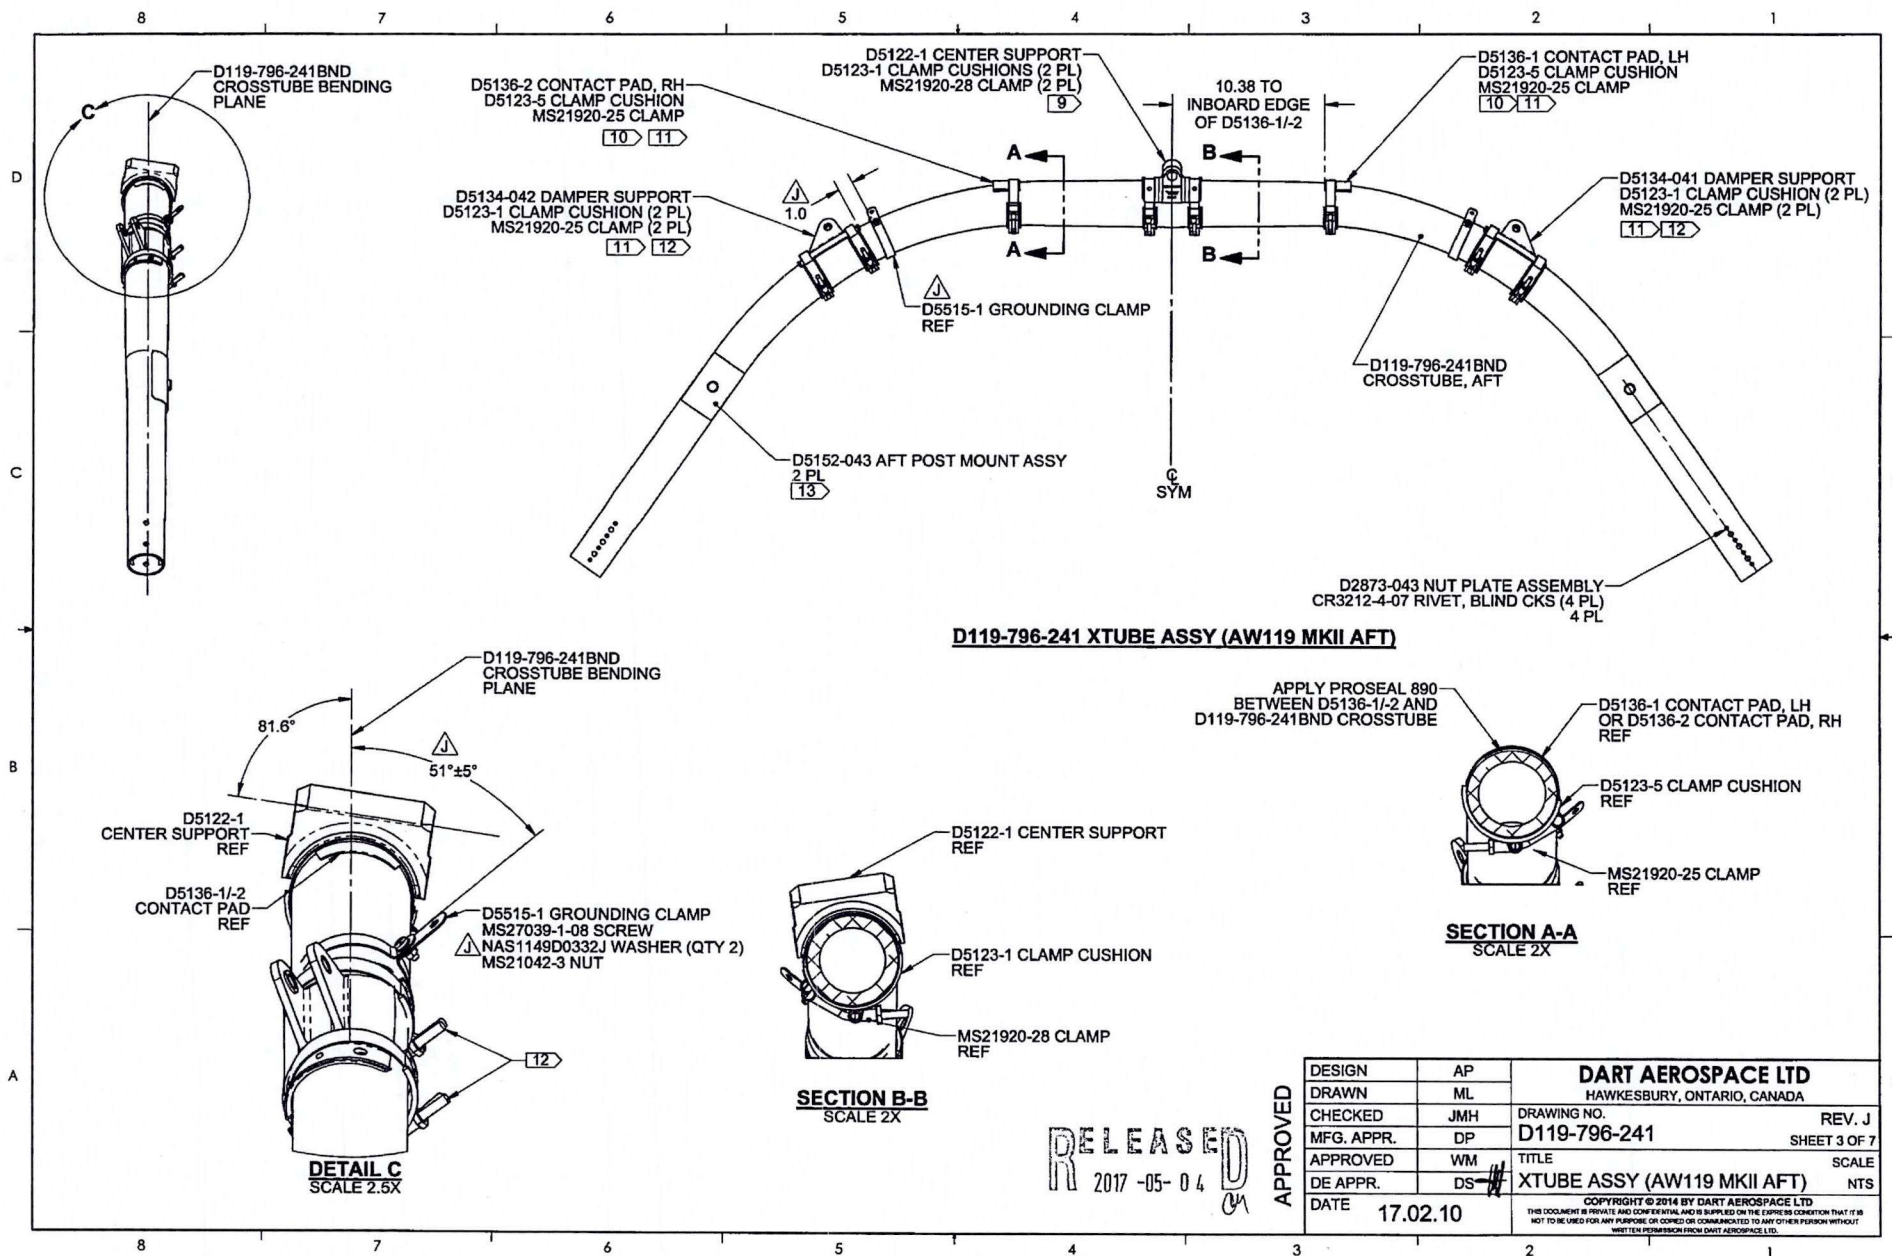

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐		DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date : _____		Sequence #: _____		QTY Affected : _____		MRB (QSI042)	
Description Work Order Deviation				Disposition			
				Completed By			
				Lead hand / Supervisor			
				QC / QA Coordinator			
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread					
		Other/Details:					

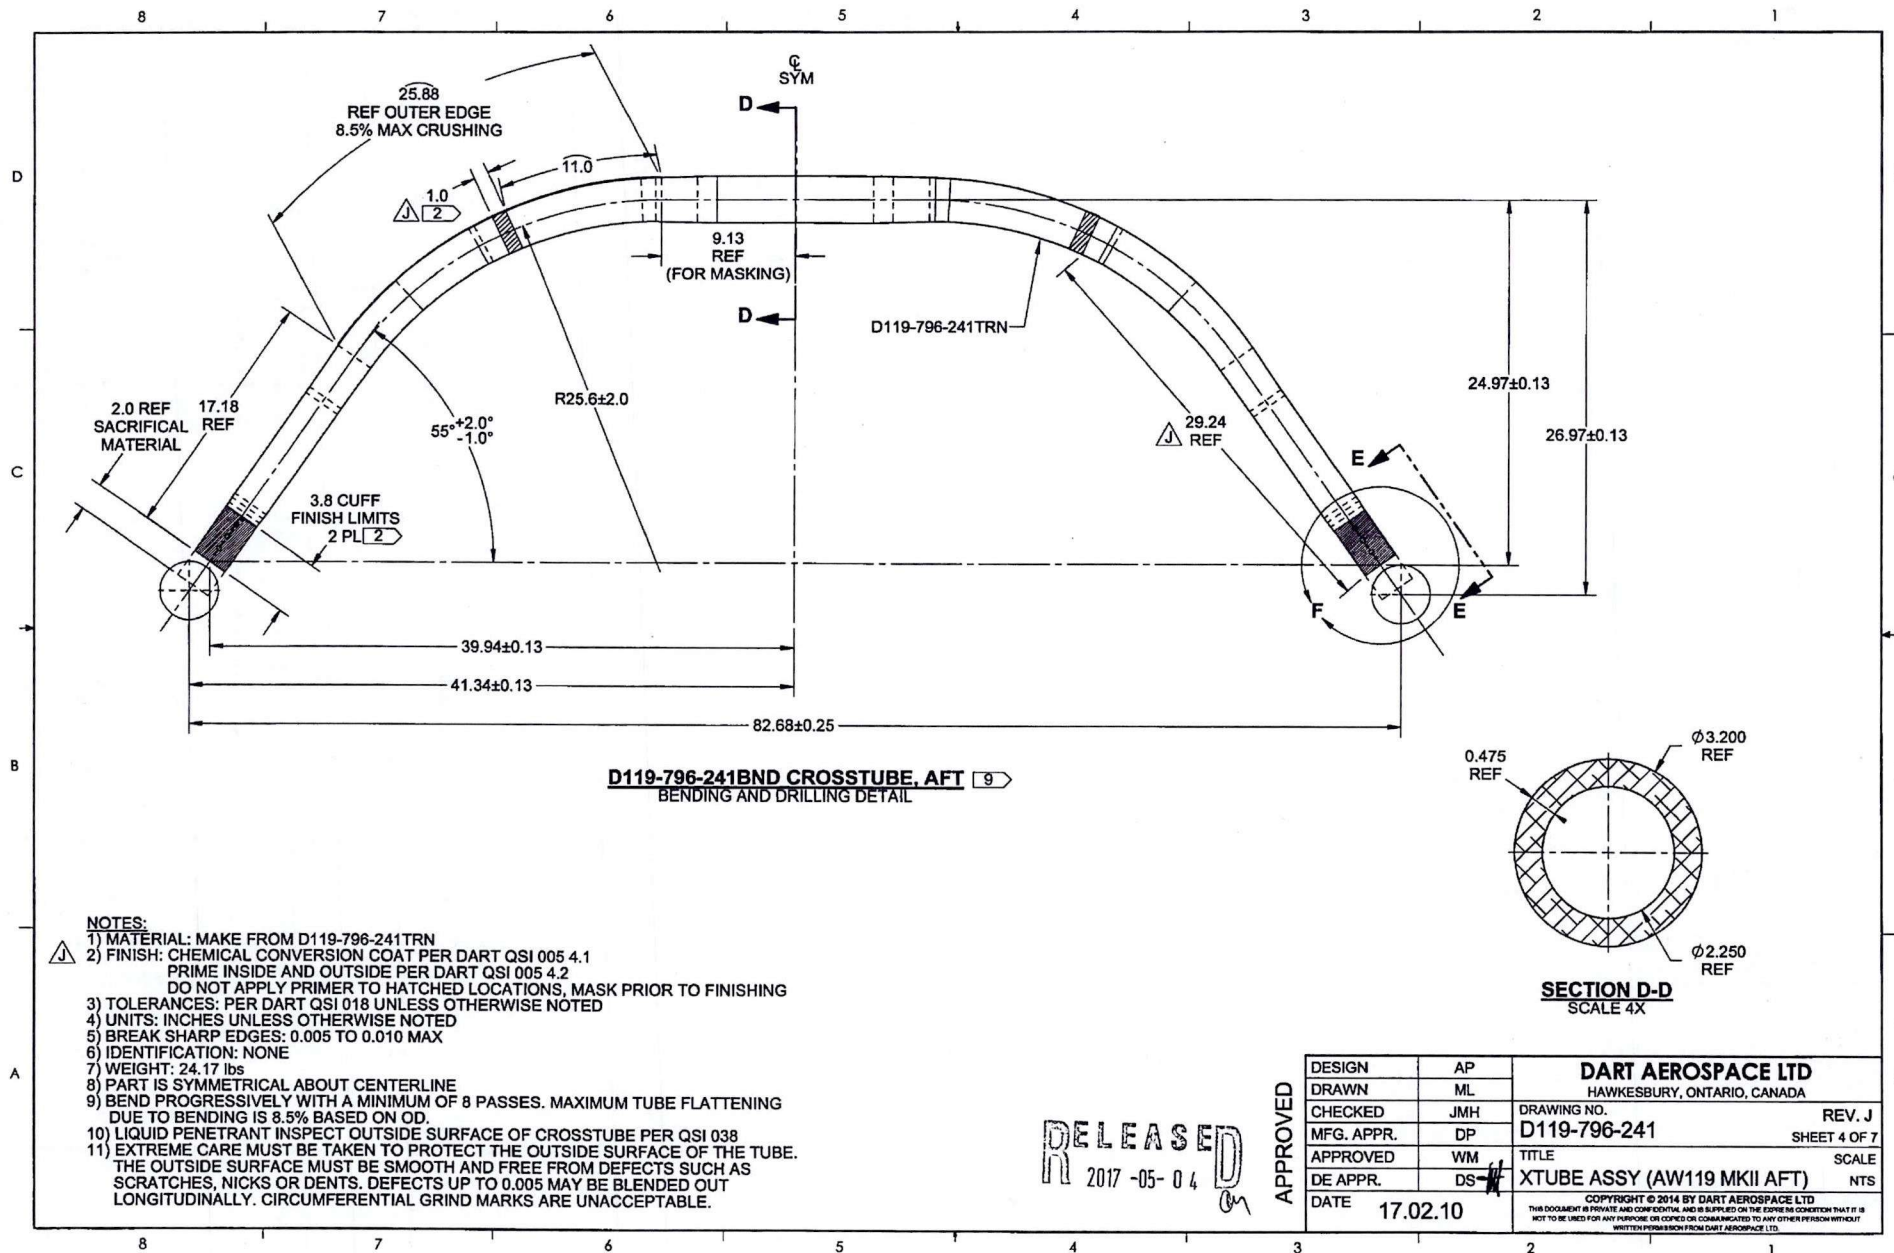

Entered: _____ Date: _____





WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

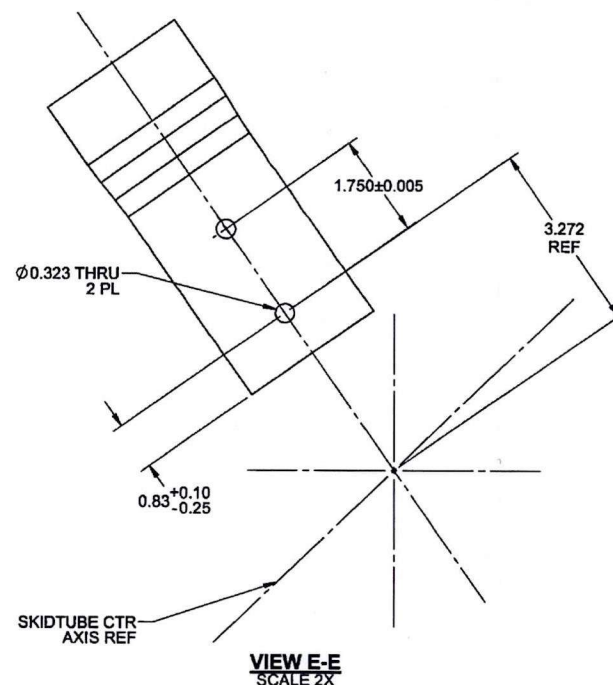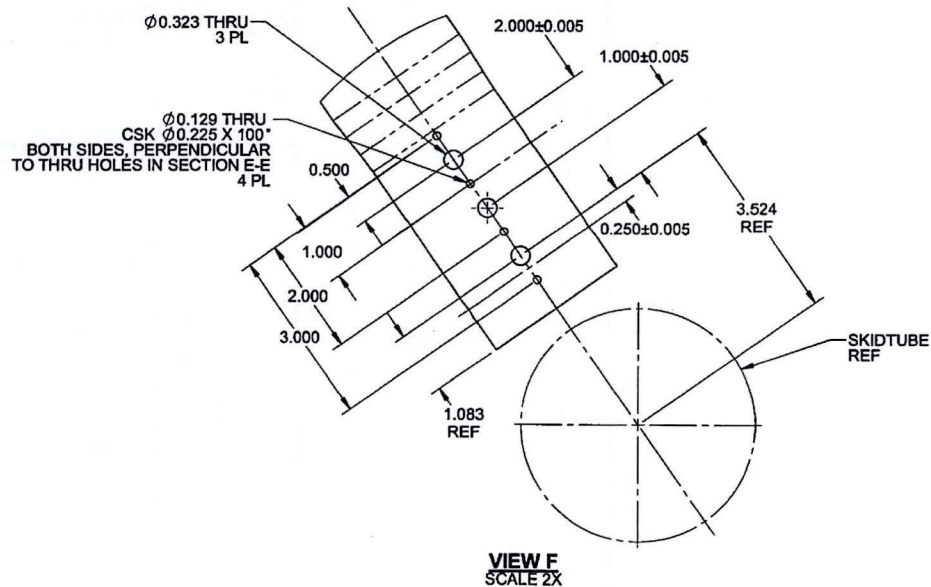

RELEASED
2017-05-04

APPROVED

DESIGN	AP	DART AEROSPACE USA, INC.	
DRAWN	ML	KENT, WA	
CHECKED	JMH	DRAWING NO.	REV. J
MFG. APPR.	DP	D119-796-241	SHEET 5 OF 7
APPROVED	WM	TITLE	SCALE
DE APPR.	DS	XTUBE ASSY (AW119 MKII AFT)	NTS
DATE	17.02.10	COPYRIGHT © 2014 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR DISCLOSED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

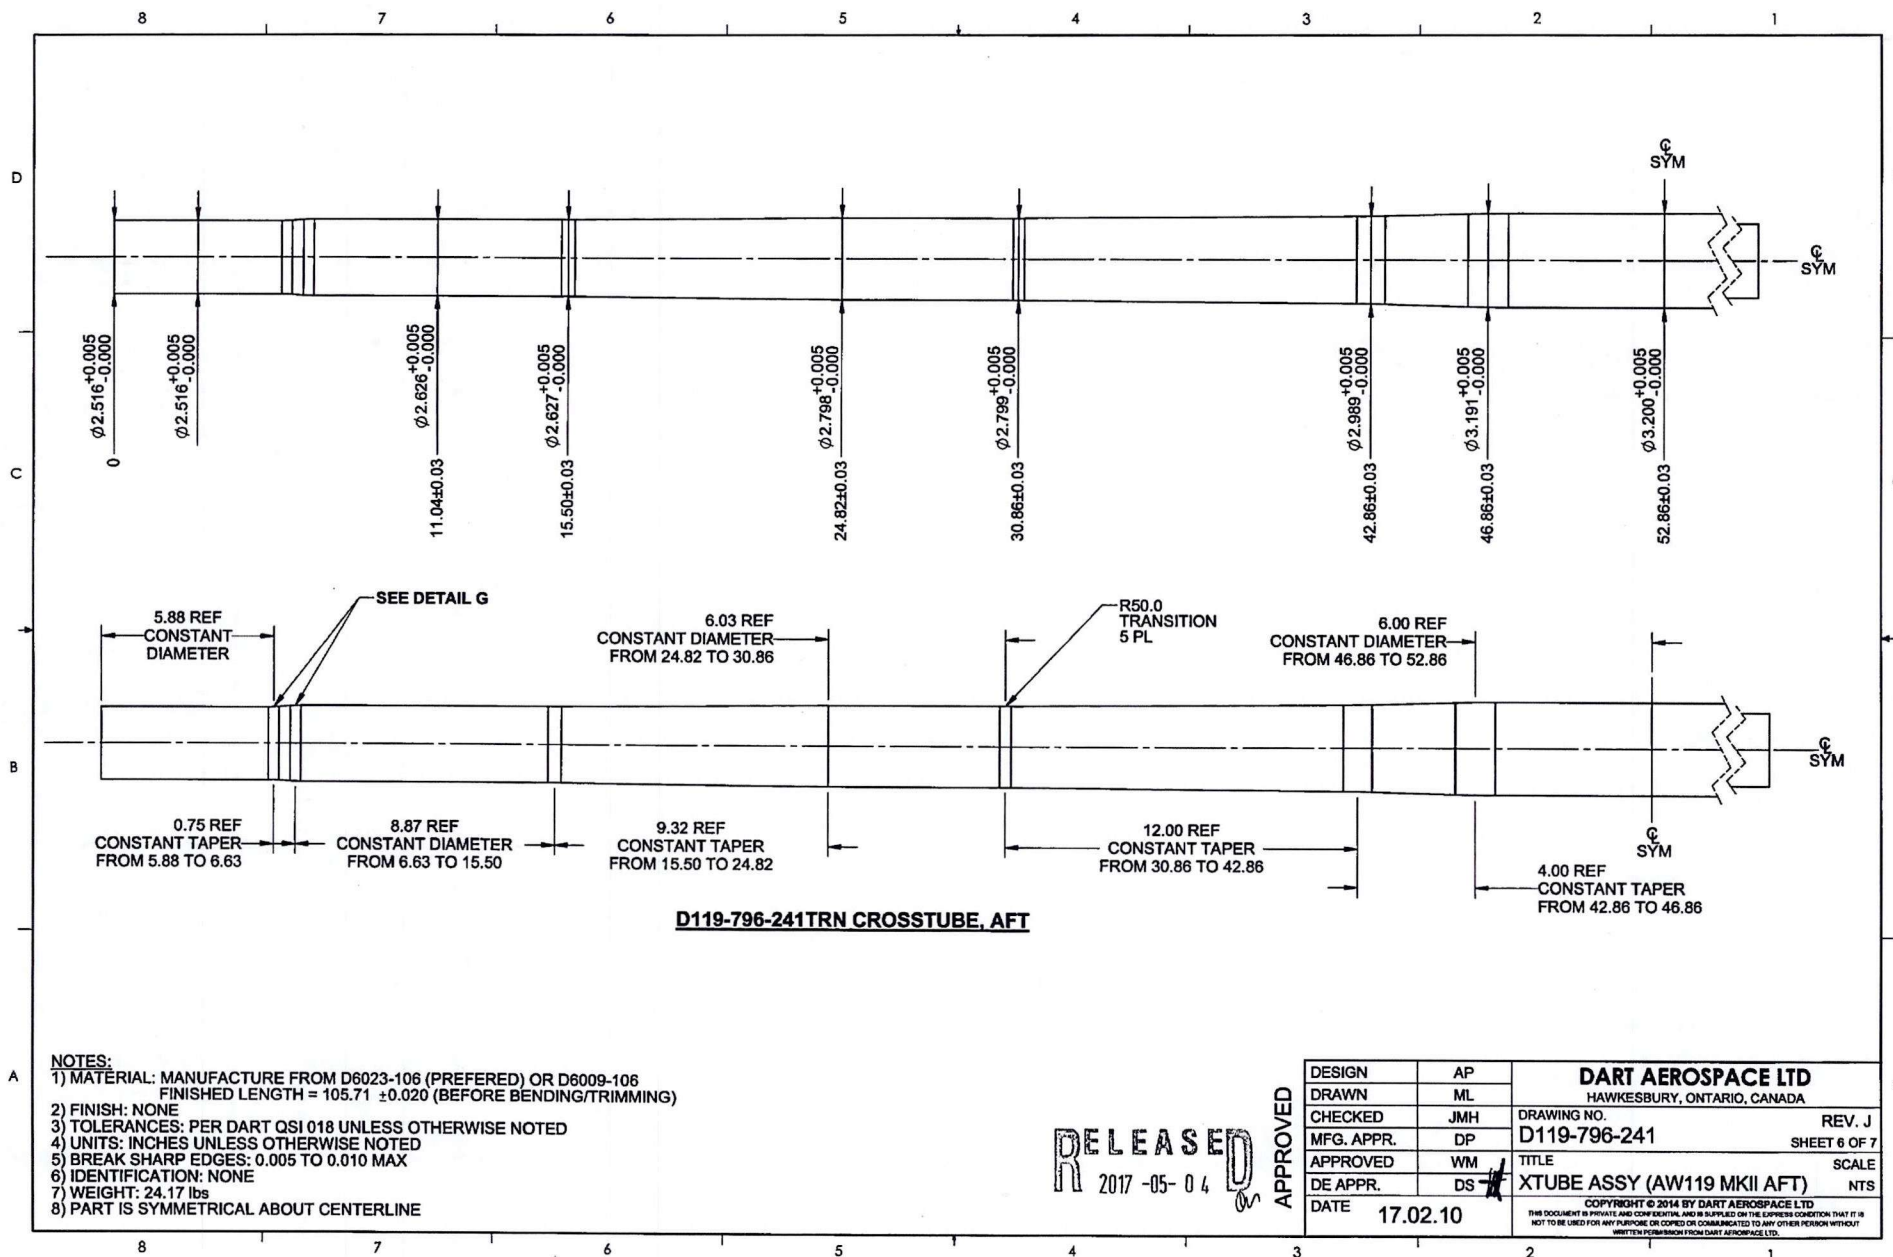

RELEASED
2017-05-04

APPROVED

DESIGN	AP	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	ML		
CHECKED	JMH	DRAWING NO.	REV. J
MFG. APPR.	DP	D119-796-241	SHEET 6 OF 7
APPROVED	WM	TITLE	SCALE
DE APPR.	DS	XTUBE ASSY (AW119 MKII AFT)	NTS
DATE	17.02.10	COPYRIGHT © 2014 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coor. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread		Other/Details:			

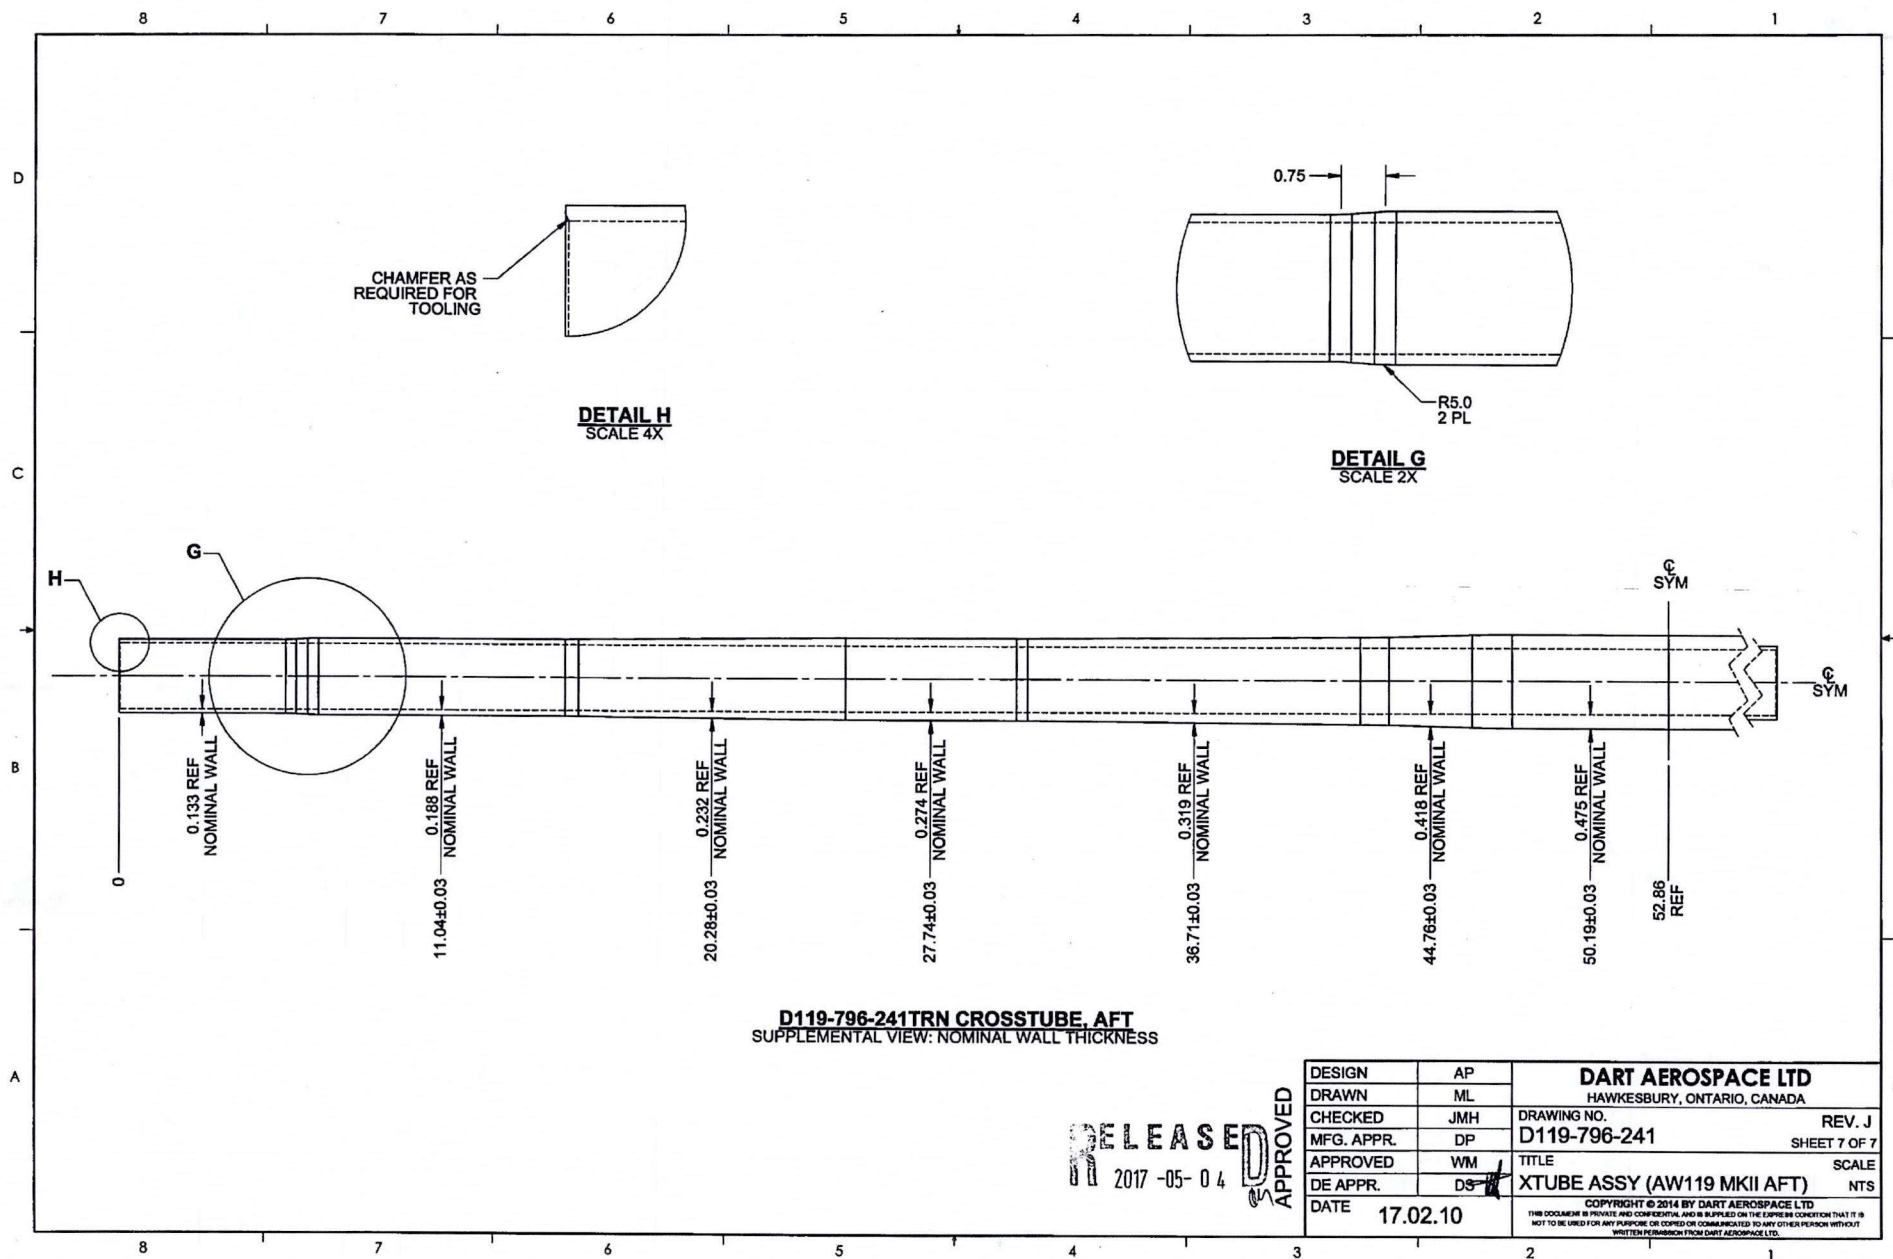

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Cross tube ☐</td> <td>Eng. (Non-AW) ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Water Jet ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Supplier ☐</td> </tr> <tr> <td></td> <td></td> <td></td> <td>Quality ☐</td> </tr> </table>				Skid-tube ☐	Cross tube ☐	Eng. (Non-AW) ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Water Jet ☐	Large Fab ☐	Finishing ☐	Rec/Store/Packaging ☐	Supplier ☐				Quality ☐																												
Skid-tube ☐	Cross tube ☐	Eng. (Non-AW) ☐	Engineering ☐																																														
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Water Jet ☐																																														
Large Fab ☐	Finishing ☐	Rec/Store/Packaging ☐	Supplier ☐																																														
			Quality ☐																																														
Date : _____	Sequence #: _____	QTY Affected : _____		MRB (QSI042)																																													
Description Work Order Deviation			Disposition																																														
			Completed By																																														
			Lead hand / Supervisor																																														
			QC / QA Coordinator																																														
Root Cause <table style="width: 100%;"> <tr><td>Operator</td><td>☐</td></tr> <tr><td>Manufacturing Process</td><td>☐</td></tr> <tr><td>Equip/Tooling</td><td>☐</td></tr> <tr><td>Handling/Preservation</td><td>☐</td></tr> <tr><td>Material</td><td>☐</td></tr> <tr><td>Product Improvement</td><td>☐</td></tr> <tr><td>Process Improvement</td><td>☐</td></tr> <tr><td>Human Factors</td><td>☐</td></tr> </table>		Operator	☐	Manufacturing Process	☐	Equip/Tooling	☐	Handling/Preservation	☐	Material	☐	Product Improvement	☐	Process Improvement	☐	Human Factors	☐	FAULT CATEGORY <table style="width: 100%;"> <tr> <td>☐ Pressure/Forced</td> <td>☐ Contamination</td> <td>☐ Power Loss/Surge</td> <td>☐ Positioned Wrong</td> </tr> <tr> <td>☐ Bending</td> <td>☐ Misaligned/off center</td> <td>☐ Folio/Program</td> <td>☐ Outside Tolerance</td> </tr> <tr> <td>☐ Crushing</td> <td>☐ BOM/Route</td> <td>☐ Grain Direction</td> <td>☐ Drawing</td> </tr> <tr> <td>☐ Cracks</td> <td>☐ Broken/Damage/Defect</td> <td>☐ Weld</td> <td>☐ Finish</td> </tr> <tr> <td>☐ Crimp/Kink/Ripple/Wave/Twist</td> <td>☐ Incomplete/Unclear Instructions</td> <td>☐ Wrong Stock Pulled</td> <td>☐ Part Lost/Missing</td> </tr> <tr> <td>☐ Marks/Chatter</td> <td>☐ Drill Holes</td> <td>☐ Out of Sequence</td> <td>☐ Misread</td> </tr> <tr> <td>☐ Mislabeled</td> <td>☐ Fit/Function</td> <td>☐ Off-set/Set-up</td> <td></td> </tr> </table>				☐ Pressure/Forced	☐ Contamination	☐ Power Loss/Surge	☐ Positioned Wrong	☐ Bending	☐ Misaligned/off center	☐ Folio/Program	☐ Outside Tolerance	☐ Crushing	☐ BOM/Route	☐ Grain Direction	☐ Drawing	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Finish	☐ Crimp/Kink/Ripple/Wave/Twist	☐ Incomplete/Unclear Instructions	☐ Wrong Stock Pulled	☐ Part Lost/Missing	☐ Marks/Chatter	☐ Drill Holes	☐ Out of Sequence	☐ Misread	☐ Mislabeled	☐ Fit/Function	☐ Off-set/Set-up	
Operator	☐																																																
Manufacturing Process	☐																																																
Equip/Tooling	☐																																																
Handling/Preservation	☐																																																
Material	☐																																																
Product Improvement	☐																																																
Process Improvement	☐																																																
Human Factors	☐																																																
☐ Pressure/Forced	☐ Contamination	☐ Power Loss/Surge	☐ Positioned Wrong																																														
☐ Bending	☐ Misaligned/off center	☐ Folio/Program	☐ Outside Tolerance																																														
☐ Crushing	☐ BOM/Route	☐ Grain Direction	☐ Drawing																																														
☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Finish																																														
☐ Crimp/Kink/Ripple/Wave/Twist	☐ Incomplete/Unclear Instructions	☐ Wrong Stock Pulled	☐ Part Lost/Missing																																														
☐ Marks/Chatter	☐ Drill Holes	☐ Out of Sequence	☐ Misread																																														
☐ Mislabeled	☐ Fit/Function	☐ Off-set/Set-up																																															
Other/Details:																																																	